


Operating manual Analogue refractometer

KERN ORA 80 BE Analogue Expert 2x Brix scale

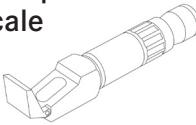

KERN & Sohn GmbH

Ziegelei 1 Tel: +49-[0]7433-9933-0
D-72336 Balingen Fax: +49-[0]7433-9933-149
E-Mail: info@kern-sohn.com Internet: www.kern-sohn.com

Version 1.1 05/2016


CONTENTS

1	Technical data.....	1
2	Description	2
3	General information	3
3.1	Intended use	3
3.2	Warranty	3
4	Basic safety information	4
4.1	Follow the instructions in the operating manual	4
4.2	Warning	4-5
5	Supplied items.....	5
6	Before the first use.....	6
7	Use/measurement.....	6
7.1	Zero point calibration.....	7-8
7.2	Additional advice.....	9
7.3	Measuring procedure	9-10
8	Cleaning and maintenance.....	11
9	Storage.....	11
10	Service	11
11	Disposal	12
12	Additional information.....	12
13	Brix to refractive index (nD) conversion table.....	13
14	Annex	14

1. Technische Daten


Models KERN	Measuring range and Scales	Scale graduations Accuracy	Dimensions Product	Net weight
ORA 80BE	Brix: 0-50% Brix: 50-80%	0,5 % Brix 0,5 % Brix	180x40x40mm	0,400kg

Example scale on
ORA 80 BE

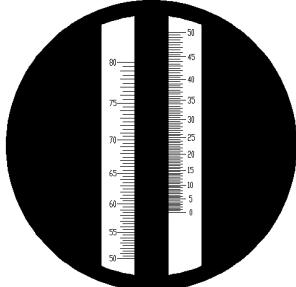


1

2. Description

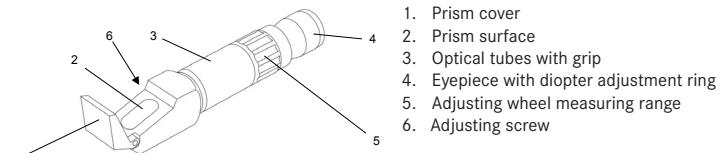

1. Prism cover
2. Prism surface
3. Optical tubes with grip
4. Eyepiece with diopter adjustment ring
5. Adjusting wheel measuring range
6. Adjusting screw

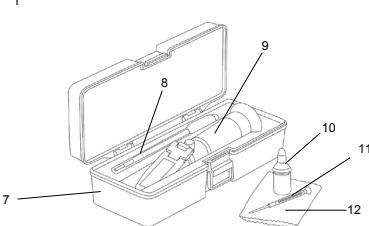

7. Storage box
8. Pipette
9. Refractometer
10. Calibration liquid
(Distilled water)
11. Adjustment tool
12. Cleaning cloth

2

3. General information

3.1 Intended use

The refractometer is a measuring instrument for determining the refractive index of transparent substances in liquid or in some cases also in the solid state. It is used to observe the behaviour of light as it passes from a prism with known properties to the substance being tested.

Use of the refractometer for other purposes is contrary to its intended use and may be hazardous. The manufacturer shall not be liable for any damages caused by improper use.

3.2 Warranty

The warranty shall be void in the event of:

- Failure to observe the instructions in the operating manual
- Use for purposes other than those described
- Modifications or opening the device housing
- Mechanical damage and/or damage resulting from media, liquids, natural wear and tear

3

4. Basic safety information

4.1 Follow the instructions in the operating manual

- Carefully read through the operating manual even if you have prior experience with KERN refractometers.
- Every language version includes a non-authoritative translation. The original German document is the definitive version.

4.2 Warning

- Do not let acids come into contact with skin or eyes. If acid comes into contact with skin, flush with copious amounts of water. Shower if larger areas of skin are affected.
- If acid comes into contact with eyes, keep the eyelid open and flush the eye with running lukewarm water from the outer corner to the inner corner. Flush eyes for at least 15 minutes. Then consult a doctor or ophthalmologist immediately.
- Thoroughly clean the refractometer after each use.
- The refractometer must not be exposed to extreme temperatures, high mechanical stresses, strong direct sunlight or high humidity.
- This refractometer is not a toy. Keep out of reach of children.
- Make sure that you will not be hit by anything else while you are using the refractometer, as this could cause serious eye injuries
- The rubber eyeshade may cause irritation when in prolonged contact with the skin. If this happens, consult your doctor.
- Do not touch the lenses with your fingers.

4

5. Supplied items

After unpacking and before using the device for the first time, check that all listed parts have been supplied. Replace damaged or faulty parts immediately and do not put them into operation.

- Refractometer
- Storage box
- Pipette
- Adjustment tool
- Cleaning cloth
- Calibration liquid (Distilled water)

5

6. Before the first use

Remove the protective film (if present) from the prism surface [2] and check that the rubber eye-cup [4] is fitted correctly.

7. Use/measurement

The refractometer can be used to quickly and accurately determine the refractive index of transparent substances, liquid or solid ones. To ensure correct measurement, the measuring device should be adjusted before measurements are carried out. Please make sure your hands are dry before handling the measuring device.

The measuring instrument has two measuring ranges. To switch between the two measuring ranges rotate the housing ring [5] between the eyepiece [4] and the optical tube [3].

6

